


INSTRUMENTATION CABLES – MAS SERIES

INDIVIDUAL & OVERALL SCREEN – STEEL WIRE ARMoured

MAS5308ESCSSWA – 8 Triple 0.5mm² TCW ESCS SWA

APPLICATION: Instrumentation Cable suitable for areas requiring mechanical protection.
Suitable for Direct Burial.

Standards	AS/NZS1125 , AS/NZS3808 , IEC 60332-1-2 , IEC 60332-3-22 , IEC 60079.14 , RoHS Compliant
Conductor	Stranded Tinned Copper Conductor 0.5mm (7/0.30mm)
Insulation	0.4mm PVC ,V90HT , White/Black/Red Triad's
Screen	Individual & Overall Shield of Ali/Polyester Foil c/w Tinned Copper Drain Wire (7/0.20mm)
Armour	Galvanized Steel Wire
Sheath	SPVC , 5V-90 , Flame Retardant , UV Resistant Black PVC
Operating Temp.	-20°C to +90°C
Rated Voltage	110VRMS/150VDC
Insulation Voltage Rating	300V
Max. Current Rating	3.2 Amp
Max. DC Resistance @ 20°C	38.4 Ω/km
Max. Capacitance Cond. To Cond. (Screened)	145 pF/m
Max. Capacitance Cond. To Scr. (Screened)	240 pF/m
Inductance @ 1kHz	1.00 mH/km
L/R Ratio @ 1kHz	13.7 μH/Ω
Insulation Resistance	140 MΩ/km
Bending Radius (Fixed)	10D (D = Cable Diameter)

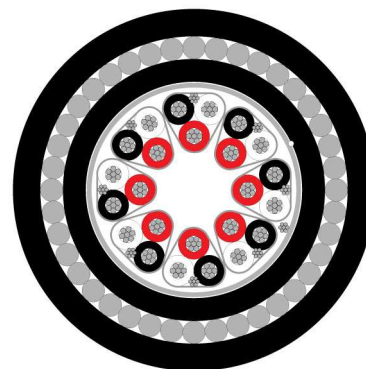

Product	Triads	Conductor	O.D over Bedding	GSWA Size	O.D over GSWA	Outer Sheath Thickness	Nominal Cable O.D	Cable Weight
Maser Ordering Code	Number of Triads	mm ²	mm	mm	mm	mm	mm	Kg/km
MAS5308ESCSSWA	8 Triad	0.5mm	14.1	1.25	16.6	1.6	19.8	835

Jacket Marking

MASER MAS5308ESCSSWA INSTRUMENTATION CABLE 8TR 0.5mm² TCW/PVC/ESCS/PVC/SWA/PVC V90 UV RoHS (MANUFACTURE DATE) (METRE MARK)

Recommended Gland = MM-E1W-25S

Disclaimer: Although Maser Communications NZ Limited makes every reasonable effort to ensure their accuracy at the time of this publication, information and specifications described herein are subject to error or omission and to change without notice. Maser provides the information and specifications herein on an "AS IS" basis, with no representations or warranties, whether express, statutory or implied. In no event will Maser be liable for any damages (including consequential, indirect, incidental, special, punitive, or exemplary damages) whatsoever, even if Maser has been advised of the possibility of such damages, whether in an action under contract, negligence or any other theory, arising out of or in connection with the use, or inability to use, the information or specifications described herein.